

Date : 12/10/2025
Project No : 2024C217
Client Company : Artisan
Arrival Time : 12/10/2025 14:00
Onsite Hours : 02:30

ASEC Report ID : 88455
Name of the Project : Naturewalk - 7 Hills Amenities
Project Location : Dallas
Weather : Sunny
Departure Time : 12/10/2025 16:30
ASEC Technician Name : Clyde Smith

On the above date the writer was on site as requested and attended a meeting with Paulding co. members and NWGP to discuss asphalt deficiencies and repairs at east and west sides deceleration lanes. Paulding Co. made issues with in place topping mix stating that a traffic roller wasn't used during 12.5 topping mix and also stated that it appeared that a binder mix was placed instead of the required topping mix based on a gradation report and appearance showing minor surface cracking. Paulding Co. recommended to remove all 12.5 topping mix and replace. Also one section on Seven Hills Blvd. near exit lane from site was recommended to be milled 9.5" and replaced with 8.0" of class B concrete and capped with 1.5" of 12.5 topping mix. The paving contractor was informed to notify ASEC for repair placement.



East side decel lane showing topping mix



Core #4 location at east side decel lane



Area to be milled 9.5 "and replaced with class B concrete and topping mix



Area to be milled 9.5"

Date : 12/10/2025
Project No : 2024C217
Client Company : Artisan
Arrival Time : 12/10/2025 14:00
Onsite Hours : 02:30

ASEC Report ID : 88455
Name of the Project : Naturewalk - 7 Hills Amenities
Project Location : Dallas
Weather : Sunny
Departure Time : 12/10/2025 16:30
ASEC Technician Name : Clyde Smith



Showing surface cracking at decel lane east side



Showing west side decel lane to be milled and replace topping



showing surface cracking at east side decel lane

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.