

Date : 03/05/2026  
Project No : 2026C115-WO 1  
Client Company : WSP  
Arrival Time : 02/12/2026  
Onsite Hours : N/A

ASEC Report ID : 90958  
Name of the Project : Lanier Islands Parkway  
Project Location : Buford  
Weather : N/A  
Departure Time :  
ASEC Technician Name : Mahendra Mylabathula

---

**Location(S):** , ,

**Testing:** 9 Set of concrete specimens (5 per set) were cast during the cast-in-place concrete pour at the above referenced location, in accordance with ASTM C31. The specimen will remain on site for the initial 24-48 hrs curing.

**Compliance:**  Field placement of concrete appeared to be in general accordance with the project specifications (i.e., slump, temperature, etc) (refer to remarks below)  
 Deviations and/or noncompliances were noted during the field placement (refer to remarks below)

**Specimen Pick Up:** 9 Sets of concrete specimens/ 5 specimen per set were picked up & transported to AS Engineering and Consulting LLC (ASEC) for curing and testing in accordance with ASTM C39, C670/1231

**Field Curing:** Specimen were stored for the initial 24 hours  
 Near the poured structure  
 In an insulated curing box  
 Other

**Remarks:**

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.

Date : 03/05/2026  
 Project No : 2026C115-WO 1  
 Client Company : WSP  
 Arrival Time : 02/12/2026  
 Onsite Hours : N/A

ASEC Report ID : 90958  
 Name of the Project : Lanier Islands Parkway  
 Project Location : Buford  
 Weather : N/A  
 Departure Time :  
 ASEC Technician Name : Mahendra Mylabathula


**PLACEMENT INFORMATION - Cylinder**

<b>Set Number:</b> 01	<b>Laboratory Number:</b> 2026-027
<b>Date Sampled:</b> 02/12/2026	<b>Time Sampled:</b> N/A
<b>Sampled By:</b> Mahendra Mylabathula	<b>Concrete Supplier:</b> N/A
<b>Contractor:</b> N/A	<b>Mix ID:</b> N/A
<b>Truck Number:</b> N/A	<b>Quantity of Load:</b> N/A
<b>Time Batched:</b> N/A	<b>Specified Strength:</b> N/A
<b>Location of Placement:</b> N/A	<b>Concrete Temp (°f):</b> N/A
<b>Number of Samples Cast:</b> 5	<b>Air Content (%):</b> N/A
<b>Ambient Temp (°f):</b> N/A	<b>Unit Weight (pcf):</b> N/A
<b>Slump (in.):</b> N/A	<b>Water Added (gal.):</b> N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
A	02/19/2026	02/19/2026	7	3.96	12.32	47177	3830	N/A	Type 6
B	03/12/2026	03/12/2026	27	4.00	12.57	67807	5390	N/A	Type 2
C	03/12/2026	03/12/2026	27	4.00	12.57	70500	5610	N/A	Type 2
D	03/12/2026	03/12/2026	27	4.00	12.57	67194	5350	N/A	Type 2
E	04/09/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed

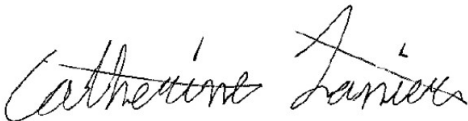

Catherine Lanier  
 Lab Manager



Kenneth Mosman

Date : 03/05/2026  
 Project No : 2026C115-WO 1  
 Client Company : WSP  
 Arrival Time : 02/12/2026  
 Onsite Hours : N/A

ASEC Report ID : 90958  
 Name of the Project : Lanier Islands Parkway  
 Project Location : Buford  
 Weather : N/A  
 Departure Time :  
 ASEC Technician Name : Mahendra Mylabathula


**PLACEMENT INFORMATION - Cylinder**

<b>Set Number:</b> 02	<b>Laboratory Number:</b> 2026-027
<b>Date Sampled:</b> 02/12/2026	<b>Time Sampled:</b> N/A
<b>Sampled By:</b> Mahendra Mylabathula	<b>Concrete Supplier:</b> N/A
<b>Contractor:</b> N/A	<b>Mix ID:</b> N/A
<b>Truck Number:</b> N/A	<b>Quantity of Load:</b> N/A
<b>Time Batched:</b> N/A	<b>Specified Strength:</b> N/A
<b>Location of Placement:</b> N/A	<b>Concrete Temp (°f):</b> N/A
<b>Number of Samples Cast:</b> 5	<b>Air Content (%):</b> N/A
<b>Ambient Temp (°f):</b> N/A	<b>Unit Weight (pcf):</b> N/A
<b>Slump (in.):</b> N/A	<b>Water Added (gal.):</b> N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
A	02/19/2026	02/19/2026	7	3.97	12.38	50081	4050	N/A	Type 5
B	03/12/2026	03/12/2026	27	4.00	12.57	63508	5050	N/A	Type 2
C	03/12/2026	03/12/2026	27	4.00	12.57	69142	5500	N/A	Type 2
D	03/12/2026	03/12/2026	27	4.00	12.57	75429	6000	N/A	Type 2
E	04/09/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed

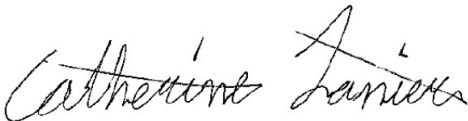

Catherine Lanier  
 Lab Manager



Kenneth Mosman

Date : 03/05/2026  
 Project No : 2026C115-WO 1  
 Client Company : WSP  
 Arrival Time : 02/12/2026  
 Onsite Hours : N/A

ASEC Report ID : 90958  
 Name of the Project : Lanier Islands Parkway  
 Project Location : Buford  
 Weather : N/A  
 Departure Time :  
 ASEC Technician Name : Mahendra Mylabathula


**PLACEMENT INFORMATION - Cylinder**

<b>Set Number:</b> 03	<b>Laboratory Number:</b> 2026-027
<b>Date Sampled:</b> 02/12/2026	<b>Time Sampled:</b> N/A
<b>Sampled By:</b> Mahendra Mylabathula	<b>Concrete Supplier:</b> N/A
<b>Contractor:</b> N/A	<b>Mix ID:</b> N/A
<b>Truck Number:</b> N/A	<b>Quantity of Load:</b> N/A
<b>Time Batched:</b> N/A	<b>Specified Strength:</b> N/A
<b>Location of Placement:</b> N/A	<b>Concrete Temp (°f):</b> N/A
<b>Number of Samples Cast:</b> 5	<b>Air Content (%):</b> N/A
<b>Ambient Temp (°f):</b> N/A	<b>Unit Weight (pcf):</b> N/A
<b>Slump (in.):</b> N/A	<b>Water Added (gal.):</b> N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
A	02/19/2026	02/19/2026	7	3.96	12.32	55719	4520	N/A	Type 3
B	03/12/2026	03/12/2026	27	4.00	12.57	68672	5460	N/A	Type 2
C	03/12/2026	03/12/2026	27	4.00	12.57	71618	5700	N/A	Type 2
D	03/12/2026	03/12/2026	27	4.00	12.57	71252	5670	N/A	Type 2
E	04/09/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed

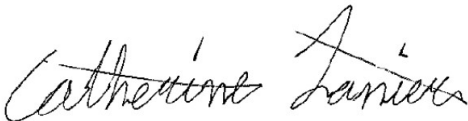

Catherine Lanier  
 Lab Manager



Kenneth Mosman