

Date : 02/24/2025  
Project No : 2022C205  
Client Company : Pulte  
Arrival Time : 02/24/2025 10:00  
Onsite Hours : 02:00

ASEC Report ID : 77876  
Name of the Project : Enclave at Parkway Village  
Project Location : Union City  
Weather : sunny  
Departure Time : 02/24/2025 12:00  
ASEC Technician Name : Vamsi Polisetty

As requested, the site was visited by our AS Engineering and Consulting (ASEC) representative for the purpose of providing quality control inspection and testing services. Visual observation techniques were employed to verify compliance with project drawing/specifications, applicable codes, and materials submittals. The following observations were observed on site this day.

#### Footings Inspection (Lot #67)

A Dynamic Cone Penetrometer (DCP) test was performed on two sides of Lot #67, revealing the presence of small stones and rocks.

- Dynamic Cone Penetrometer (DCP) observations were recorded up to a depth of 4 feet below the ground surface, with the following details:

**Northwest Side:** It can be noted that the area to the northwest of the job site corresponds to the Front of the site.

- At 1 foot: 07 blows (Soft Brown sandy soil with small stones is Observed)
- At 2 feet: 08 blows (Mix of Soft Brown and white sandy soil with small stones is Observed)
- At 3 feet: 08 blows (Mix of Soft Brown and white sandy soil with small stones is Observed)
- At 4 feet: 08 blows (Mix of Soft Brown and white sandy soil with small stones is Observed)

**SouthEast Side:** It can be noted that the area to the Southeast of the job site corresponds to the Back of the site.

- At 1 foot: 08 blows (Soft Brown sandy soil with small stones is Observed)
- At 2 feet: 07 blows (Mix of Soft Brown and white sandy soil with small stones is Observed)
- At 3 feet: 08 blows (Mix of Soft Brown and white sandy soil with small stones is Observed)
- At 4 feet: 09 blows (Mix of Soft Brown and white sandy soil with small stones is Observed)

General probing shows that the subgrade appears to be stable. Minor recommendations included removing loose soils from the footing. The reinforcement appears to meet job specifications for size, spacing and quantity. Rock Boulders are observed in the job site.

We appreciate the opportunity to be of service to you on this project. If you have any questions regarding this report, please feel free to contact us. We will be more than happy to discuss it with you.

ASEC Report ID : 77876  
Name of the Project : Enclave at Parkway Village  
Project Location : Union City  
Weather : sunny  
Departure Time : 02/24/2025 12:00  
ASEC Technician Name : Vamsi Polisetty

Date : 02/24/2025  
Project No : 2022C205  
Client Company : Pulte  
Arrival Time : 02/24/2025 10:00  
Onsite Hours : 02:00



ASEC Report ID : 77876  
Name of the Project : Enclave at Parkway Village  
Project Location : Union City  
Weather : sunny  
Departure Time : 02/24/2025 12:00  
ASEC Technician Name : Vamsi Polisetty

Date : 02/24/2025  
Project No : 2022C205  
Client Company : Pulte  
Arrival Time : 02/24/2025 10:00  
Onsite Hours : 02:00



ASEC Report ID : 77876  
Name of the Project : Enclave at Parkway Village  
Project Location : Union City  
Weather : sunny  
Departure Time : 02/24/2025 12:00  
ASEC Technician Name : Vamsi Polisetty

Date : 02/24/2025  
Project No : 2022C205  
Client Company : Pulte  
Arrival Time : 02/24/2025 10:00  
Onsite Hours : 02:00




ASEC Report ID : 77876  
Name of the Project : Enclave at Parkway Village  
Project Location : Union City  
Weather : sunny  
Departure Time : 02/24/2025 12:00  
ASEC Technician Name : Vamsi Polisetty

Date : 02/24/2025  
Project No : 2022C205  
Client Company : Pulte  
Arrival Time : 02/24/2025 10:00  
Onsite Hours : 02:00



ASEC Report ID : 77876  
Name of the Project : Enclave at Parkway Village  
Project Location : Union City  
Weather : sunny  
Departure Time : 02/24/2025 12:00  
ASEC Technician Name : Vamsi Polisetty

Date : 02/24/2025  
Project No : 2022C205  
Client Company : Pulte  
Arrival Time : 02/24/2025 10:00  
Onsite Hours : 02:00

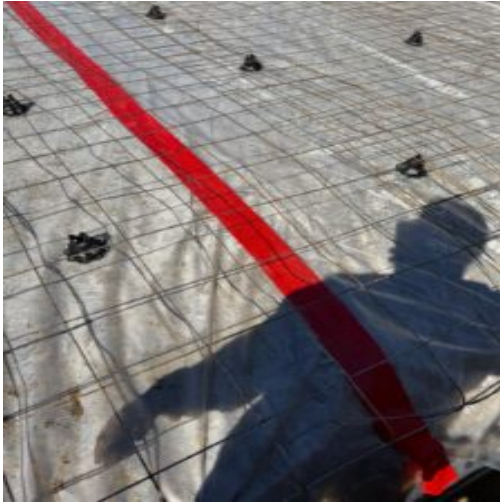

ASEC Report ID : 77876  
Name of the Project : Enclave at Parkway Village  
Project Location : Union City  
Weather : sunny  
Departure Time : 02/24/2025 12:00  
ASEC Technician Name : Vamsi Polisetty

Date : 02/24/2025  
Project No : 2022C205  
Client Company : Pulte  
Arrival Time : 02/24/2025 10:00  
Onsite Hours : 02:00



**Ramchandra R. Mogulla**  
**GA P.E. 036021**  
**Senior Engineer**

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.