

Date : 04/23/2026  
Project No : 2023C159  
Client Company : CW Matthews  
Arrival Time : 04/23/2026 15:30  
Onsite Hours : 14:00

ASEC Report ID : 93411  
Name of the Project : Airfield Repairs 2021-23  
Project Location : HJAIA, Atlanta, GA  
Weather : clear  
Departure Time : 04/24/2026 05:30  
ASEC Technician Name : Samara Simha Reddy Kandi

---

As requested, the site was visited by our AS Engineering and Consulting (ASEC) representative for the purpose of providing quality control inspection and testing services. Visual observation techniques were employed to verify compliance with project drawing/specifications, applicable codes, and materials submittals. The following observations were observed on site this day.

**Area 1:**

Proof-rolled in day shift, crew placed a 6-inch layer of GAB and compacted using trench compactor and smooth drum roller. Density tests were performed and met the required compaction.

**Area 2:**

Sheet piles were cut approximately 2 feet below grade. Work continued with placement of M10 material as backfill. The material was compacted using a sheep-foot roller. Density tests were performed and initially did not meet the required compaction. Additional compaction was performed, and after re-testing, it met required compaction. Final grade was then compacted using a smooth drum roller, and performed density tests it met the required compaction.

**Area 3:**

Straps were removed, and waterproofing activities were performed.

**Area 4:**

Sheet piles were marked approximately 2 feet below grade.

**Area 5:**

Compaction activities were performed. Density tests were performed and did not meet the required compaction. It was recommended to add water and continue re-compacting.



**Area 6:**

Waterproofing activities were completed.

We appreciate the opportunity to be of service to you on this project. If you have any questions regarding this report, please feel free to contact us. We will be more than happy to discuss it with you.



Date : 04/23/2026  
Project No : 2023C159  
Client Company : CW Matthews  
Arrival Time : 04/23/2026 15:30  
Onsite Hours : 14:00

ASEC Report ID : 93411  
Name of the Project : Airfield Repairs 2021-23  
Project Location : HJAIA, Atlanta, GA  
Weather : clear  
Departure Time : 04/24/2026 05:30  
ASEC Technician Name : Samara Simha Reddy Kandi

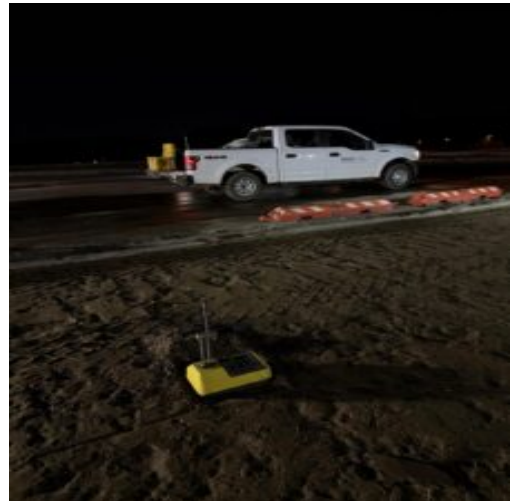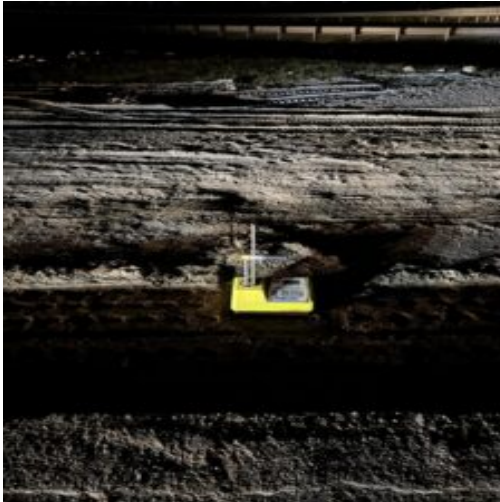


Date : 04/23/2026  
Project No : 2023C159  
Client Company : CW Matthews  
Arrival Time : 04/23/2026 15:30  
Onsite Hours : 14:00

ASEC Report ID : 93411  
Name of the Project : Airfield Repairs 2021-23  
Project Location : HJAIA, Atlanta, GA  
Weather : clear  
Departure Time : 04/24/2026 05:30  
ASEC Technician Name : Samara Simha Reddy Kandi

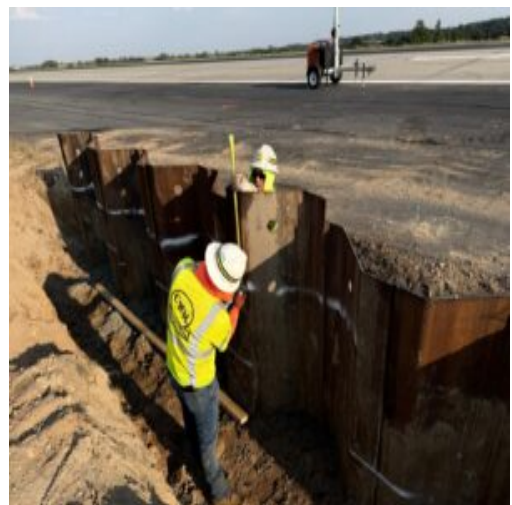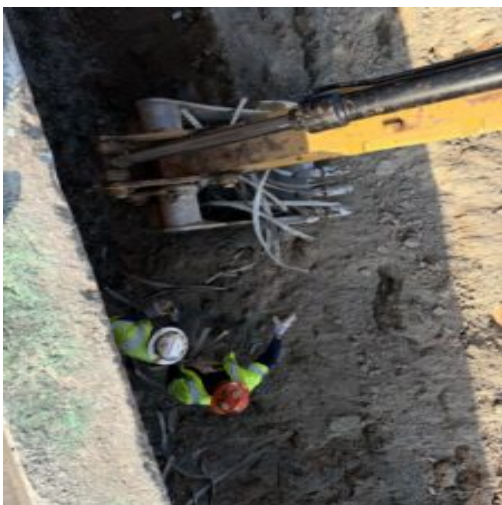

Date : 04/23/2026  
Project No : 2023C159  
Client Company : CW Matthews  
Arrival Time : 04/23/2026 15:30  
Onsite Hours : 14:00

ASEC Report ID : 93411  
Name of the Project : Airfield Repairs 2021-23  
Project Location : HJAJA, Atlanta, GA  
Weather : clear  
Departure Time : 04/24/2026 05:30  
ASEC Technician Name : Samara Simha Reddy Kandi

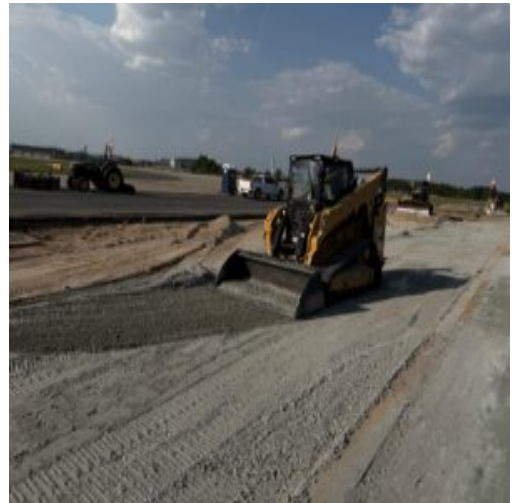

*Kenneth Mosman*

**Kenneth Mosman**

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.