

Date : 04/24/2026
Project No : 2023C159
Client Company : CW Matthews
Arrival Time : 04/24/2026 14:00
Onsite Hours : 16:00

ASEC Report ID : 93620
Name of the Project : Airfield Repairs 2021-23
Project Location : HJAJA, Atlanta, GA
Weather : clear
Departure Time : 04/25/2026 06:00
ASEC Technician Name : Samara Simha Reddy Kandi

As requested, the site was visited by our AS Engineering and Consulting (ASEC) representative for the purpose of providing quality control inspection and testing services. Visual observation techniques were employed to verify compliance with project drawing/specifications, applicable codes, and materials submittals. The following observations were observed on site this day.

Area 3:

No. 89 stone was placed as a base layer. Following this, fill material was placed in controlled lifts. Each lift was compacted using a trench compactor to achieve proper density and stability. The work progressed systematically lift by lift.

Area 4:

Fill material was placed and compacted using a sheep foot roller. Density tests were performed and did not meet the required compaction due to excessive moisture present between the layers. To address this, the crew mixed GAB with the existing material to improve gradation and reduce moisture effects. The area was then re-compacted, and subsequent tests met the required compaction. Work continued with placement and compaction of additional lifts in a controlled manner.

Area 6:



GAB material was placed as fill and compacted using a trench compactor, sheep foot roller and smooth drum roller. Compaction activities were carried out to ensure proper support and stability of the layer.

We appreciate the opportunity to be of service to you on this project. If you have any questions regarding this report, please feel free to contact us. We will be more than happy to discuss it with you.




Date : 04/24/2026
Project No : 2023C159
Client Company : CW Matthews
Arrival Time : 04/24/2026 14:00
Onsite Hours : 16:00

ASEC Report ID : 93620
Name of the Project : Airfield Repairs 2021-23
Project Location : HJAIA, Atlanta, GA
Weather : clear
Departure Time : 04/25/2026 06:00
ASEC Technician Name : Samara Simha Reddy Kandi

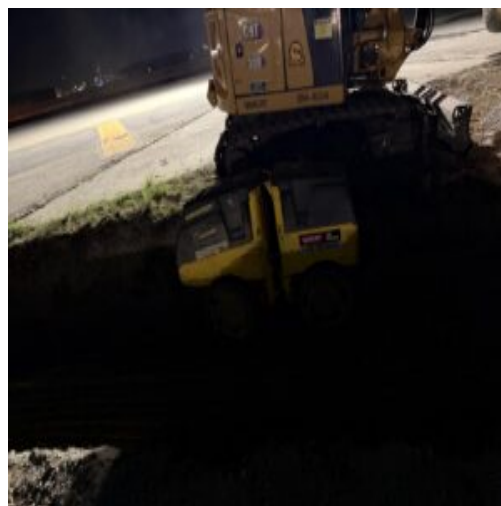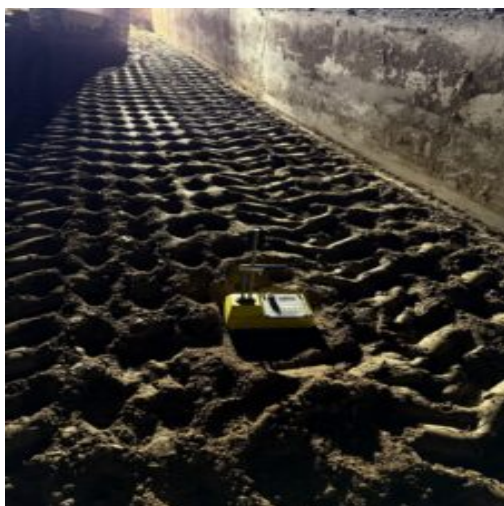


Date : 04/24/2026
Project No : 2023C159
Client Company : CW Matthews
Arrival Time : 04/24/2026 14:00
Onsite Hours : 16:00

ASEC Report ID : 93620
Name of the Project : Airfield Repairs 2021-23
Project Location : HJAIA, Atlanta, GA
Weather : clear
Departure Time : 04/25/2026 06:00
ASEC Technician Name : Samara Simha Reddy Kandi

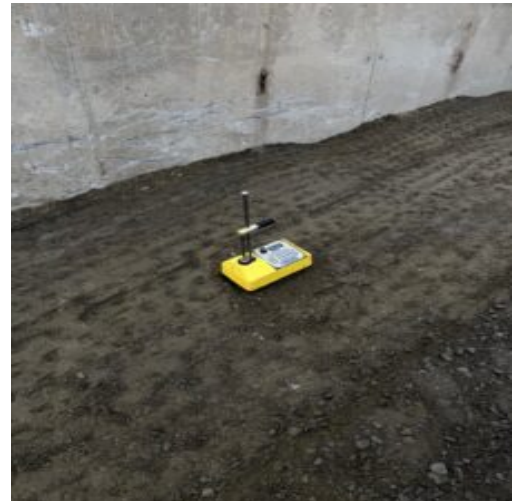

Date : 04/24/2026
Project No : 2023C159
Client Company : CW Matthews
Arrival Time : 04/24/2026 14:00
Onsite Hours : 16:00

ASEC Report ID : 93620
Name of the Project : Airfield Repairs 2021-23
Project Location : HJAIA, Atlanta, GA
Weather : clear
Departure Time : 04/25/2026 06:00
ASEC Technician Name : Samara Simha Reddy Kandi

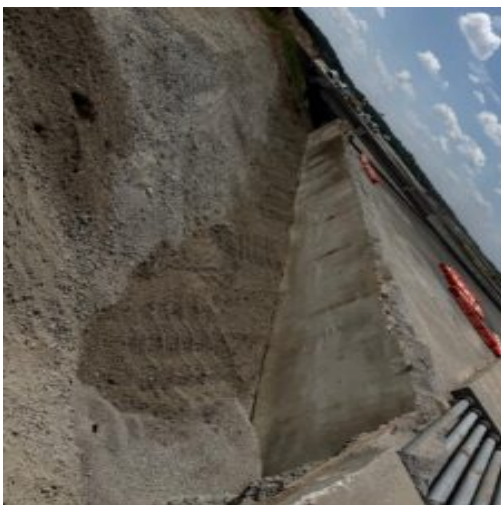

Date : 04/24/2026
Project No : 2023C159
Client Company : CW Matthews
Arrival Time : 04/24/2026 14:00
Onsite Hours : 16:00

ASEC Report ID : 93620
Name of the Project : Airfield Repairs 2021-23
Project Location : HJAJA, Atlanta, GA
Weather : clear
Departure Time : 04/25/2026 06:00
ASEC Technician Name : Samara Simha Reddy Kandi

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.