


Date : 01/15/2025
Project No : 2024C202
Client Company : CCG
Arrival Time : 07:30
Onsite Hours :

ASEC Report ID : 75846
Name of the Project : Old Griffin Rd - Hawthorne Reserve
Project Location : Dallas
Weather : Clear sky
Departure Time : 01/15/2025 15:30
ASEC Technician Name : Solomon Cherie

The down cutting and backfill activity was done for a while, but stopped due to high moisture content and allow compaction. Nuclear gauge test shows 32% moisture and way below 95% compaction. As a result tilling and scarification was proposed and backfill is stopped for a while.

- After scarification, the dirt was spread and packed.

Then another backfill was done for the road way. Another dirt was dug and was in good moisture and high compaction of 99% was observed.

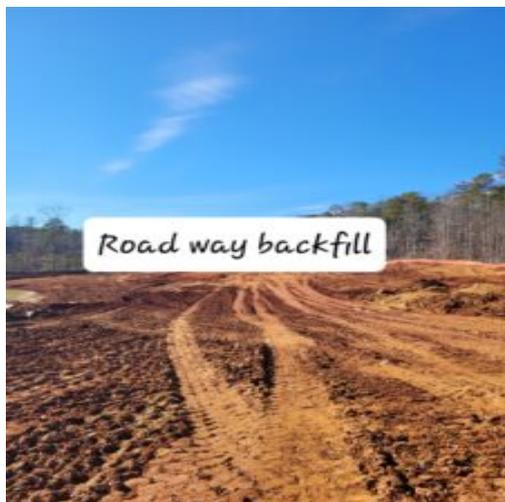

Scarified to drop the moisture and repack

Kenneth Mosman

Kenneth Mosman

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.