

Date : 07/16/2025
Project No : 2024C217
Client Company : Artisan
Arrival Time : 07/16/2025 09:00
Onsite Hours : 06:30

ASEC Report ID : 83060
Name of the Project : Naturewalk - 7 Hills Amenities
Project Location : Dallas
Weather : Mostly Cloudy
Departure Time : 07/16/2025 15:30
ASEC Technician Name : Safiullah Momand

As requested, the site was visited by our AS Engineering and Consulting (ASEC) representative for the purpose of providing quality control inspection and testing services. Visual observation techniques were employed to verify compliance with project drawing/specifications, applicable codes, and materials submittals. The following observations were observed on site this day.

Ongoing Activities:

1. Preparation of the entrance road (right side of Shalley Boulevard) for subgrade proof-rolling.
2. Placement of Graded Aggregate Base (GAB) on the left side of the entrance road (left side of Shalley Boulevard).
3. Curb removal at the deceleration lane on the west side of the project – Nature Walk, 7 Hills Amenities.

Observations and Recommendations by ASEC:

Subgrade proof-rolling for the entrance road (right side of Shalley Boulevard) was conducted at 1:00 PM in the presence of representatives from Paulding County (Mr. Mike Keener), the site contractor, and our ASEC representative. Based on the proof-roll evaluation, ASEC provided the following recommendations:

- **Portion 1:** Undercut an area measuring 53 ft x 15 ft to a minimum depth of 4 inches and place GAB in the undercut area.
- **Portion 2:** Undercut an area measuring 197 ft x 12 ft to a minimum depth of 4 inches and place GAB in the undercut area.
- **Portion 3:** Undercut an area measuring 77 ft x 12 ft to a minimum depth of 4 inches and place GAB in the undercut area.
- **Portion 4:** Undercut an area measuring 23 ft x 8 ft to a minimum depth of 4 inches and place GAB in the undercut area.

(All areas are marked and documented in the attached site photographs.)

Date : 07/16/2025
Project No : 2024C217
Client Company : Artisan
Arrival Time : 07/16/2025 09:00
Onsite Hours : 06:30

ASEC Report ID : 83060
Name of the Project : Naturewalk - 7 Hills Amenities
Project Location : Dallas
Weather : Mostly Cloudy
Departure Time : 07/16/2025 15:30
ASEC Technician Name : Safiullah Momand

We appreciate the opportunity to be of service to you on this project. If you have any questions regarding this report, please feel free to contact us. We will be more than happy to discuss it with you.




Subgrade prepared for Proof role purpose



Subgrade prepared for Proof role purpose



Subgrade prepared for Proof role purpose

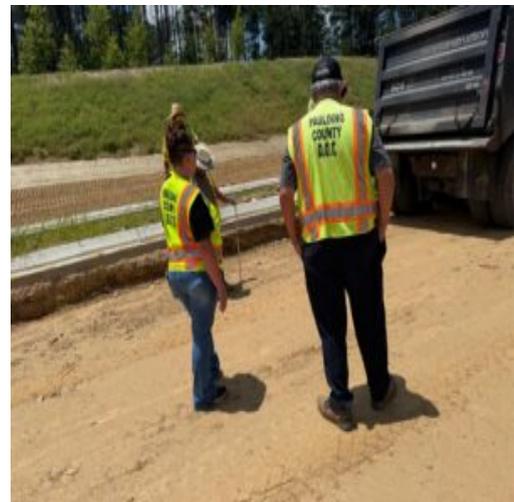

Proof Rolling with county, contractor and ASEC

Date : 07/16/2025
Project No : 2024C217
Client Company : Artisan
Arrival Time : 07/16/2025 09:00
Onsite Hours : 06:30

ASEC Report ID : 83060
Name of the Project : Naturewalk - 7 Hills Amenities
Project Location : Dallas
Weather : Mostly Cloudy
Departure Time : 07/16/2025 15:30
ASEC Technician Name : Safiullah Momand



Proof Rolling with county, contractor and ASEC



Marked places after proof rolling



Marked places after proof rolling



GAB work ongoing

Date : 07/16/2025
Project No : 2024C217
Client Company : Artisan
Arrival Time : 07/16/2025 09:00
Onsite Hours : 06:30

ASEC Report ID : 83060
Name of the Project : Naturewalk - 7 Hills Amenities
Project Location : Dallas
Weather : Mostly Cloudy
Departure Time : 07/16/2025 15:30
ASEC Technician Name : Safiullah Momand



Curb removal work at the deceleration Lane West



GAB work



Curb removal work at the deceleration Lane West

Kenneth Mosman

Kenneth Mosman

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.