

Daily Field Report

Date: 09/16/2025 Project No: 2024C217 Client Company: Artisan Arrival Time: 09/16/2025 07:30

Onsite Hours: 07:00

ASEC Report ID : 86013 Name of the Project : Naturewalk - 7 Hills Amenities Project Location : Dallas

 $Weather: N/A\\ Departure\ Time: 09/16/2025\ 14:30\\ ASEC\ Technician\ Name: Sean\ Willett$

As requested, the site was visited by our AS Engineering and Consulting (ASEC) representative for the purpose of providing quality control inspection and testing services. Visual observation techniques were employed to verify compliance with project drawing/specifications, applicable codes, and materials submittals. The following observations were observed on site this day.


Site Location: Azalea Crossing - 7 Hills

Our ASEC representative was on site as requested by the contractor (Service Titan) for the observation/testing of the placement of fill/backfill. The contractor removed GAB and approximately 6 in to 8 in of soft/loose soils. The contractor then placed GAB and added water before compacting with a vibrating smooth drum roller.

Our ASEC rep met with the contractor and Mr. Keener of Paulding County DOT to perform a proof-roll of this area. There was some pumping present in front of sewer/storm drains, so in these areas it was recommended to remove approximately 6 in of GAB and fill with extra asphalt. The rest of the proof-roll showed no severe pumping and/or rutting of the GAB that was placed.

We appreciate the opportunity to be of service to you on this project. If you have any questions regarding this report, please feel free to contact us. We will be more than happy to discuss it with you.



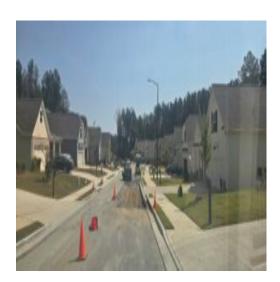




Daily Field Report


 $\begin{array}{c} {\rm ASEC\ Report\ ID:86013} \\ {\rm Name\ of\ the\ Project:Naturewalk-7\ Hills\ Amenities} \\ {\rm Project\ Location:Dallas} \end{array}$

Weather : N/A

Departure Time: 09/16/2025 14:30 ASEC Technician Name: Sean Willett


Date: 09/16/2025 Project No: 2024C217 Client Company: Artisan Arrival Time: 09/16/2025 07:30 Onsite Hours: 07:00

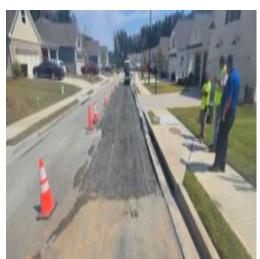

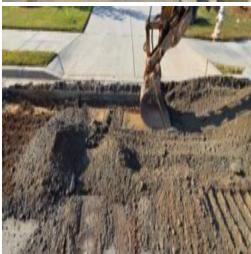





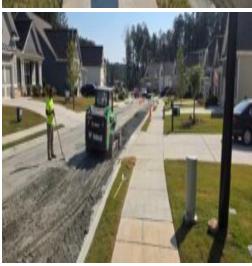



Daily Field Report

Date: 09/16/2025 Project No: 2024C217 Client Company: Artisan Arrival Time: 09/16/2025 07:30

Onsite Hours: 07:00

 $\begin{array}{c} \textbf{ASEC Report ID: 86013} \\ \textbf{Name of the Project: Naturewalk - 7 Hills Amenities} \\ \textbf{Project Location: Dallas} \end{array}$

Weather: N/A

 $\begin{array}{c} \textbf{Departure Time}: 09/16/2025\ 14:30\\ \textbf{ASEC Technician Name}: \textbf{Sean Willett} \end{array}$

Kenneth Mosman

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consultiing LLC.