

Date : 03/19/2026
Project No : 2025C149
Client Company : Davidson Homes
Arrival Time :
Onsite Hours : N/A

ASEC Report ID : 91924
Name of the Project : Grove at E. Thompson Mill Rd
Project Location : Buford
Weather : N/A
Departure Time :
ASEC Technician Name : Samara Simha Reddy Kandi

Location(S): , , ,

Testing: 4 Set of concrete specimens (6 per set) were cast during the cast-in-place concrete pour at the above referenced location, in accordance with ASTM C31. The specimen will remain on site for the initial 24-48 hrs curing.

Compliance: Field placement of concrete appeared to be in general accordance with the project specifications (i.e., slump, temperature, etc) (refer to remarks below)
 Deviations and/or noncompliances were noted during the field placement (refer to remarks below)

Specimen Pick Up: 4 Sets of concrete specimens/ 6 specimen per set were picked up & transported to AS Engineering and Consulting LLC (ASEC) for curing and testing in accordance with ASTM C39, C670/1231

Field Curing: Specimen were stored for the initial 24 hours
 Near the poured structure
 In an insulated curing box
 Other

Remarks:

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.

Date : 03/19/2026
 Project No : 2025C149
 Client Company : Davidson Homes
 Arrival Time :
 Onsite Hours : N/A

ASEC Report ID : 91924
 Name of the Project : Grove at E. Thompson Mill Rd
 Project Location : Buford
 Weather : N/A
 Departure Time :
 ASEC Technician Name : Samara Simha Reddy Kandi


PLACEMENT INFORMATION - Cylinder

Set Number: A	Laboratory Number: 2026-061
Date Sampled: 03/19/2026	Time Sampled: N/A
Sampled By: Samara Simha Reddy Kandi	Concrete Supplier: N/A
Contractor: N/A	Mix ID: N/A
Truck Number: N/A	Quantity of Load: N/A
Time Batched: N/A	Specified Strength: N/A
Location of Placement: N/A	Concrete Temp (°f): N/A
Number of Samples Cast: 6	Air Content (%): N/A
Ambient Temp (°f): N/A	Unit Weight (pcf): N/A
Slump (in.): N/A	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	03/26/2026	03/26/2026	7	3.98	12.41	69390	5520	N/A	Type 2
2	03/26/2026	03/26/2026	7	3.98	12.44	74235	5910	N/A	Type 2
3	04/16/2026	04/16/2026	28	3.98	12.41	74235	5980	N/A	Type 5
4	04/16/2026	04/16/2026	28	3.98	12.41	87804	7080	N/A	Type 2
5	04/16/2026	04/16/2026	28	3.98	12.41	89547	7220	N/A	Type 2
6	05/14/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed

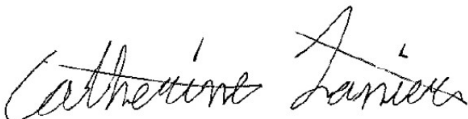

Catherine Lanier
 Lab Manager



Kenneth Mosman

Date : 03/19/2026
 Project No : 2025C149
 Client Company : Davidson Homes
 Arrival Time :
 Onsite Hours : N/A

ASEC Report ID : 91924
 Name of the Project : Grove at E. Thompson Mill Rd
 Project Location : Buford
 Weather : N/A
 Departure Time :
 ASEC Technician Name : Samara Simha Reddy Kandi


PLACEMENT INFORMATION - Cylinder

Set Number: B	Laboratory Number: 2026-061
Date Sampled: 03/19/2026	Time Sampled: N/A
Sampled By: Samara Simha Reddy Kandi	Concrete Supplier: N/A
Contractor: N/A	Mix ID: N/A
Truck Number: N/A	Quantity of Load: N/A
Time Batched: N/A	Specified Strength: N/A
Location of Placement: N/A	Concrete Temp (°f): N/A
Number of Samples Cast: 6	Air Content (%): N/A
Ambient Temp (°f): N/A	Unit Weight (pcf): N/A
Slump (in.): N/A	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	03/26/2026	03/26/2026	7	3.97	12.38	64716	5230	N/A	Type 5
2	03/26/2026	03/26/2026	7	3.96	12.35	67474	5460	N/A	Type 1
3	04/16/2026	04/16/2026	28	3.96	12.35	87161	7060	N/A	Type 2
4	04/16/2026	04/16/2026	28	3.96	12.35	89347	7230	N/A	Type 2
5	04/16/2026	04/16/2026	28	3.96	12.35	85639	6930	N/A	Type 2
6	05/14/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed

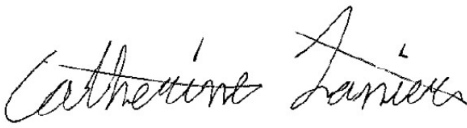

Catherine Lanier
 Lab Manager



Kenneth Mosman

Date : 03/19/2026
 Project No : 2025C149
 Client Company : Davidson Homes
 Arrival Time :
 Onsite Hours : N/A

ASEC Report ID : 91924
 Name of the Project : Grove at E. Thompson Mill Rd
 Project Location : Buford
 Weather : N/A
 Departure Time :
 ASEC Technician Name : Samara Simha Reddy Kandi


PLACEMENT INFORMATION - Cylinder

Set Number: C	Laboratory Number: 2026-061
Date Sampled: 03/19/2026	Time Sampled: N/A
Sampled By: Samara Simha Reddy Kandi	Concrete Supplier: N/A
Contractor: N/A	Mix ID: N/A
Truck Number: N/A	Quantity of Load: N/A
Time Batched: N/A	Specified Strength: N/A
Location of Placement: N/A	Concrete Temp (°f): N/A
Number of Samples Cast: 6	Air Content (%): N/A
Ambient Temp (°f): N/A	Unit Weight (pcf): N/A
Slump (in.): N/A	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	03/26/2026	03/26/2026	7	3.97	12.38	72829	5880	N/A	Type 2
2	03/26/2026	03/26/2026	7	3.96	12.35	71260	5770	N/A	Type 3
3	04/16/2026	04/16/2026	28	3.96	12.35	88478	7160	N/A	Type 2
4	04/16/2026	04/16/2026	28	3.96	12.35	89478	7250	N/A	Type 3
5	04/16/2026	04/16/2026	28	3.96	12.35	88996	7210	N/A	Type 2
6	05/14/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed

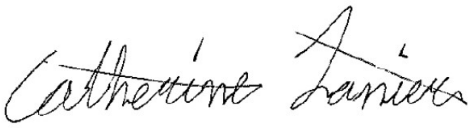

Catherine Lanier
 1
 Lab Manager



Kenneth Mosman

Date : 03/19/2026
 Project No : 2025C149
 Client Company : Davidson Homes
 Arrival Time :
 Onsite Hours : N/A

ASEC Report ID : 91924
 Name of the Project : Grove at E. Thompson Mill Rd
 Project Location : Buford
 Weather : N/A
 Departure Time :
 ASEC Technician Name : Samara Simha Reddy Kandi


PLACEMENT INFORMATION - Cylinder

Set Number: D	Laboratory Number: 2026-061
Date Sampled: 03/19/2026	Time Sampled: N/A
Sampled By: Samara Simha Reddy Kandi	Concrete Supplier: N/A
Contractor: N/A	Mix ID: N/A
Truck Number: N/A	Quantity of Load: N/A
Time Batched: N/A	Specified Strength: N/A
Location of Placement: N/A	Concrete Temp (°f): N/A
Number of Samples Cast: 6	Air Content (%): N/A
Ambient Temp (°f): N/A	Unit Weight (pcf): N/A
Slump (in.): N/A	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	03/26/2026	03/26/2026	7	3.97	12.38	77144	6230	N/A	Type 2
2	03/26/2026	03/26/2026	7	3.96	12.35	73070	5920	N/A	Type 2
3	04/16/2026	04/16/2026	28	3.96	12.35	96328	7800	N/A	Type 3
4	04/16/2026	04/16/2026	28	3.96	12.29	90980	7400	N/A	Type 3
5	04/16/2026	04/16/2026	28	3.96	12.35	96312	7800	N/A	Type 2
6	05/14/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed

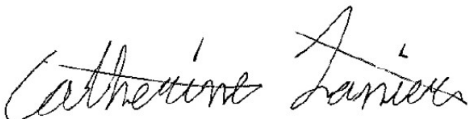

Catherine Lanier
 Lab Manager



Kenneth Mosman