

Date : 04/03/2025
Project No : 2025C160
Client Company : Artisan
Arrival Time : 04/03/2025 10:00
Onsite Hours : 06:00

ASEC Report ID : 79413
Name of the Project : Rockmart Township - 115 Felton Drive
Project Location : Rockmart
Weather : Overcast
Departure Time : 04/03/2025 16:00
ASEC Technician Name : Sean Willett

As requested, the site was visited by our AS Engineering and Consulting (ASEC) representative for the purpose of providing quality control inspection and testing services. Visual observation techniques were employed to verify compliance with project drawing/specifications, applicable codes, and materials submittals. The following observations were observed on site this day.


Our ASEC representative was onsite as requested by the contractor (Willbanks) for the observation/testing of soil placement. Our representative observed a proof-roll for the approximate location of Lots #121, through #126. The proof-roll displayed not signs of severe pumping and/or rutting. A moisture content test of the fill placed was taken and found to be 20 to 23%. Fill was placed in approximately 8in lifts. The contractor was notified of the high moisture contents and recommended spreading the fill to allow it to aerate to approximately 15.5% (+/- 3%) moisture content. The contractor agreed and began placing fill in approximately 8in lifts on the proof rolled lots to allow it to dry before compaction. Compaction tests were approximately 86% for Lot #121. The contractor was recommended to allow ample time for drying, and to recompact the materials tomorrow to retest for compaction. Proof-rolling of Lot #33 was performed with of which no severe pumping/rutting was observed.

We appreciate the opportunity to be of service to you on this project. If you have any questions regarding this report, please feel free to contact us. We will be more than happy to discuss it with you.



Date : 04/03/2025
Project No : 2025C160
Client Company : Artisan
Arrival Time : 04/03/2025 10:00
Onsite Hours : 06:00

ASEC Report ID : 79413
Name of the Project : Rockmart Township - 115 Felton Drive
Project Location : Rockmart
Weather : Overcast
Departure Time : 04/03/2025 16:00
ASEC Technician Name : Sean Willett

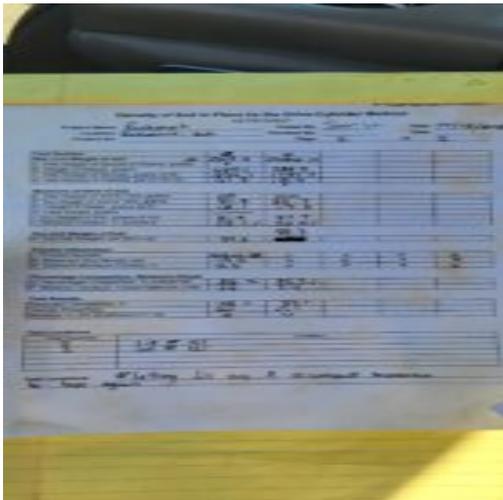

Kenneth Mosman

Kenneth Mosman

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.