

Date : 04/02/2025
Project No : 2025C160
Client Company : Artisan
Arrival Time : 04/02/2025 10:00
Onsite Hours : 05:00

ASEC Report ID : 79379
Name of the Project : Rockmart Township - 115 Felton Drive
Project Location : Rockmart
Weather : Overcast
Departure Time : 04/02/2025 15:00
ASEC Technician Name : Sean Willett

On the above date, our AS Engineering & Consulting representative was on site as requested by the contractor (HB NEXT). The technician observed the placement of fill soils - in approximately 8in lifts - in the approximate location of Lot #119 and Lot #120 (Phase 1 plans) to approximately 4 feet below finished grade. The technician observed a proof-roll of the approximate location of Lot #119. The proof-roll showed no signs of severe pumping and/or rutting. Moisture content tests were performed which resulted in approximately 25% moisture content. Optimum moisture content for the material proctor is approximately 15.5%. Our representative advised the head contractor (Randy) of the results and recommended to spread the fill out and allow it to aerate to reduce in-situ moistures prior to replacement and recompaction.

The contractor removed topsoil off Lot #38 #39 and #129 (Phase 1 plans) to conduct a proof-roll then began placing fill in approximately 8inch lifts and at a depth of 5 feet below finished grade. The proof-roll showed no signs of severe pumping and/or rutting. One lift was placed to allow for aeration of high moisture content soils. No compaction tests were performed at this time.

We appreciate the opportunity to be of service to you on this project. If you have any questions regarding this report, please feel free to contact us. We will be more than happy to discuss it with you.



approx lot #38 and #39



approx lot #38 and #39

Date : 04/02/2025
Project No : 2025C160
Client Company : Artisan
Arrival Time : 04/02/2025 10:00
Onsite Hours : 05:00

ASEC Report ID : 79379
Name of the Project : Rockmart Township - 115 Felton Drive
Project Location : Rockmart
Weather : Overcast
Departure Time : 04/02/2025 15:00
ASEC Technician Name : Sean Willett




approx lot #38 and #39



approx lot #120 and #119

Date : 04/02/2025
Project No : 2025C160
Client Company : Artisan
Arrival Time : 04/02/2025 10:00
Onsite Hours : 05:00

ASEC Report ID : 79379
Name of the Project : Rockmart Township - 115 Felton Drive
Project Location : Rockmart
Weather : Overcast
Departure Time : 04/02/2025 15:00
ASEC Technician Name : Sean Willett

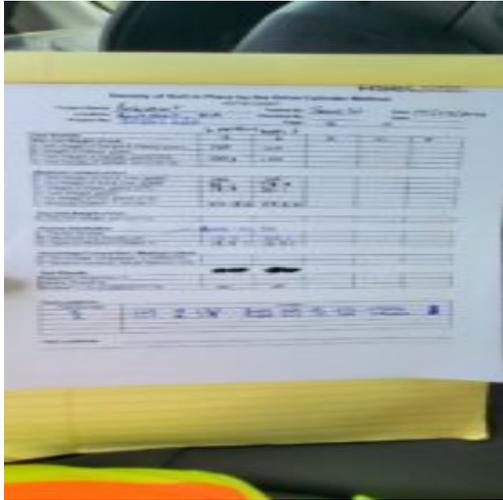

test results

Kenneth Mosman

Kenneth Mosman

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.