

Date : 06/23/2025
Project No : 2025C160
Client Company : Artisan
Arrival Time : 06/23/2025 08:00
Onsite Hours : 07:00

ASEC Report ID : 82504
Name of the Project : Rockmart Township - 115 Felton Drive
Project Location : Rockmart
Weather : sunny
Departure Time : 06/23/2025 15:00
ASEC Technician Name : Sean Willett

As requested, the site was visited by our AS Engineering and Consulting (ASEC) representative for the purpose of providing quality control inspection and testing services. Visual observation techniques were employed to verify compliance with project drawing/specifications, applicable codes, and materials submittals. The following observations were observed on site this day.

Our ASEC representative was on site as requested by the contractor (Wilbanks) for the observation/testing of the placement of fill/backfill. The technician observed the contractor placing lifts over Lots #167 - 172. Lifts were placed in approximately 8 to 12 inches in thickness. The contractor placed approximately 2 lifts and density testing will be performed in this area on the next available workday.

Our representative observed a proof-roll with a loaded offroad dump truck across the approximate location of Lots #140- 136. These lots showed signs of severe pumping and rutting. The technician recommended to excavate this area to remove wet soils and since over 10 feet of fill is required in this area, we recommend a compacted 2-foot bridge lift to start with fill placed in 1 foot lifts to follow.

The contractor (Robbie) continued working on SSMH5.1 pipeline. No testing was requested/preformed along this line.

We appreciate the opportunity to be of service to you on this project. If you have any questions regarding this report, please feel free to contact us. We will be more than happy to discuss it with you.




Date : 06/23/2025
Project No : 2025C160
Client Company : Artisan
Arrival Time : 06/23/2025 08:00
Onsite Hours : 07:00

ASEC Report ID : 82504
Name of the Project : Rockmart Township - 115 Felton Drive
Project Location : Rockmart
Weather : sunny
Departure Time : 06/23/2025 15:00
ASEC Technician Name : Sean Willett



excavated area of low compaction

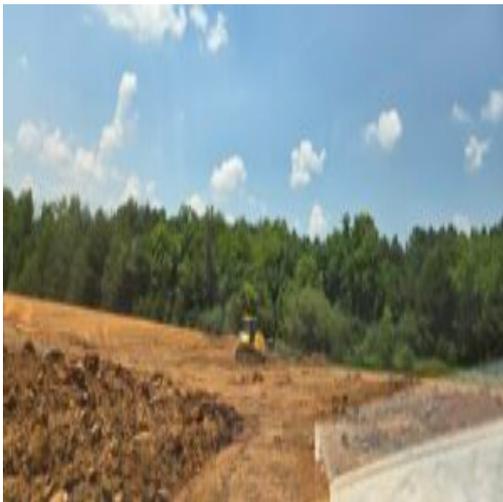

SSMH5.1

Date : 06/23/2025
Project No : 2025C160
Client Company : Artisan
Arrival Time : 06/23/2025 08:00
Onsite Hours : 07:00

ASEC Report ID : 82504
Name of the Project : Rockmart Township - 115 Felton Drive
Project Location : Rockmart
Weather : sunny
Departure Time : 06/23/2025 15:00
ASEC Technician Name : Sean Willett



lots 167 - 172



low compaction around lot 140

Kenneth Mosman

Kenneth Mosman

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.