

Date : 03/25/2026
Project No : 2025C214
Client Company : Artisan
Arrival Time : 03/25/2026 08:00
Onsite Hours : 08:00

ASEC Report ID : 91933
Name of the Project : NW Unit 4 BRIDGE (Materials Testing)
Project Location : Dallas
Weather : sunny
Departure Time : 03/25/2026 16:00
ASEC Technician Name : Mahendra Mylabathula

Location(S): CONCRETE MUD MAT 1, MUD MAT 5, MUD MAT 7

Testing: 3 Set of concrete specimens (5 per set) were cast during the cast-in-place concrete pour at the above referenced location, in accordance with ASTM C31. The specimen will remain on site for the initial 24-48 hrs curing.

Compliance: Field placement of concrete appeared to be in general accordance with the project specifications (i.e., slump, temperature, etc) (refer to remarks below)
 Deviations and/or noncompliances were noted during the field placement (refer to remarks below)

Specimen Pick Up: 3 Sets of concrete specimens/ 5 specimen per set were picked up & transported to AS Engineering and Consulting LLC (ASEC) for curing and testing in accordance with ASTM C39, C670/1231

Field Curing: Specimen were stored for the initial 24 hours
 Near the poured structure
 In an insulated curing box
 Other

Remarks:

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.

Date : 03/25/2026
 Project No : 2025C214
 Client Company : Artisan
 Arrival Time : 03/25/2026 08:00
 Onsite Hours : 08:00

ASEC Report ID : 91933
 Name of the Project : NW Unit 4 BRIDGE (Materials Testing)
 Project Location : Dallas
 Weather : sunny
 Departure Time : 03/25/2026 16:00
 ASEC Technician Name : Mahendra Mylabathula


PLACEMENT INFORMATION - Cylinder

Set Number: A	Laboratory Number: 2026-069
Date Sampled: 03/25/2026	Time Sampled: 10:
Sampled By: Mahendra Mylabathula	Concrete Supplier: ERNST
Contractor: N/A	Mix ID: NON AEA
Truck Number: 1	Quantity of Load: 9
Time Batched: 09:06	Specified Strength: 3000
Location of Placement: CONCRETE MUD MAT 1	Concrete Temp (°f): 68.48
Number of Samples Cast: 5	Air Content (%): 3.7
Ambient Temp (°f): N/A	Unit Weight (pcf): 149.6
Slump (in.): 3.75	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	04/01/2026	04/01/2026	7	3.97	12.38	31069	2510	83.7	Type 2
2	04/22/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
3	04/22/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
4	04/22/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
5	05/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed

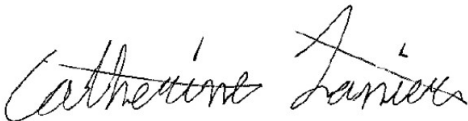

Catherine Lanier
 Lab Manager



Kenneth Mosman

Date : 03/25/2026
 Project No : 2025C214
 Client Company : Artisan
 Arrival Time : 03/25/2026 08:00
 Onsite Hours : 08:00

ASEC Report ID : 91933
 Name of the Project : NW Unit 4 BRIDGE (Materials Testing)
 Project Location : Dallas
 Weather : sunny
 Departure Time : 03/25/2026 16:00
 ASEC Technician Name : Mahendra Mylabathula


PLACEMENT INFORMATION - Cylinder

Set Number: B	Laboratory Number: 2026-070
Date Sampled: 03/25/2026	Time Sampled: 11:12
Sampled By: Mahendra Mylabathula	Concrete Supplier: ERNST
Contractor: N/A	Mix ID: NON AEA
Truck Number: 6	Quantity of Load: 9
Time Batched: N/A	Specified Strength: 3000
Location of Placement: MUD MAT 5	Concrete Temp (°f): 65
Number of Samples Cast: 5	Air Content (%): 3
Ambient Temp (°f): N/A	Unit Weight (pcf): 146.6
Slump (in.): 7	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	04/01/2026	04/01/2026	7	3.97	12.38	27878	2250	75.0	Type 1
2	04/22/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
3	04/22/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
4	04/22/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
5	05/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed

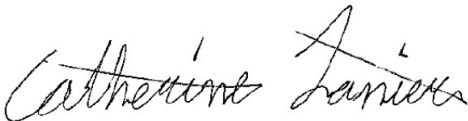

Catherine Lanier
 Lab Manager



Kenneth Mosman

Date : 03/25/2026
 Project No : 2025C214
 Client Company : Artisan
 Arrival Time : 03/25/2026 08:00
 Onsite Hours : 08:00

ASEC Report ID : 91933
 Name of the Project : NW Unit 4 BRIDGE (Materials Testing)
 Project Location : Dallas
 Weather : sunny
 Departure Time : 03/25/2026 16:00
 ASEC Technician Name : Mahendra Mylabathula


PLACEMENT INFORMATION - Cylinder

Set Number: C	Laboratory Number: 2026-071
Date Sampled: 03/25/2026	Time Sampled: 2
Sampled By: Mahendra Mylabathula	Concrete Supplier: ERNST
Contractor: N/A	Mix ID: NON AEA
Truck Number: 12	Quantity of Load: 9
Time Batched: 12:56	Specified Strength: 3000
Location of Placement: MUD MAT 7	Concrete Temp (°f): 70
Number of Samples Cast: 5	Air Content (%): 2.7
Ambient Temp (°f): N/A	Unit Weight (pcf): 148.9
Slump (in.): 3.75	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	04/01/2026	04/01/2026	7	3.97	12.38	28112	2270	75.7	Type 3
2	04/22/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
3	04/22/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
4	04/22/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
5	05/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed

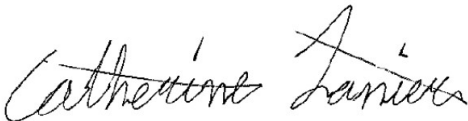

Catherine Lanier
 Lab Manager



Kenneth Mosman