

Date : 01/13/2026  
Project No : 2025C280  
Client Company : WSP  
Arrival Time : 01/13/2026 09:50  
Onsite Hours : 02:30

ASEC Report ID : 89143  
Name of the Project : Lee Road  
Project Location : Douglasville  
Weather : Clear  
Departure Time : 01/13/2026 12:20  
ASEC Technician Name : Catherine Lanier

---

**Location(S):** Intersection of Lee Rd and County Line Rd

**Testing:** 1 Set of concrete specimens (5 per set) were cast during the cast-in-place concrete pour at the above referenced location, in accordance with ASTM C31. The specimen will remain on site for the initial 24-48 hrs curing.

**Compliance:**  Field placement of concrete appeared to be in general accordance with the project specifications (i.e., slump, temperature, etc) (refer to remarks below)  
 Deviations and/or noncompliances were noted during the field placement (refer to remarks below)

**Specimen Pick Up:** 1 Sets of concrete specimens/ 5 specimen per set were picked up & transported to AS Engineering and Consulting LLC (ASEC) for curing and testing in accordance with ASTM C39, C670/1231

**Field Curing:** Specimen were stored for the initial 24 hours  
 Near the poured structure  
 In an insulated curing box  
 Other

**Remarks:**

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.

Date : 01/13/2026  
 Project No : 2025C280  
 Client Company : WSP  
 Arrival Time : 01/13/2026 09:50  
 Onsite Hours : 02:30

ASEC Report ID : 89143  
 Name of the Project : Lee Road  
 Project Location : Douglasville  
 Weather : Clear  
 Departure Time : 01/13/2026 12:20  
 ASEC Technician Name : Catherine Lanier


**PLACEMENT INFORMATION - Cylinder**

<b>Set Number:</b> 2026-005	<b>Laboratory Number:</b> 2026-005
<b>Date Sampled:</b> 01/13/2026	<b>Time Sampled:</b> 12:00
<b>Sampled By:</b> Catherine Lanier	<b>Concrete Supplier:</b> Thomas
<b>Contractor:</b> Curb and Gutter Contracting Co.	<b>Mix ID:</b> 190341
<b>Truck Number:</b> 1510	<b>Quantity of Load:</b> 9
<b>Time Batched:</b> 10:38	<b>Specified Strength:</b> 3000
<b>Location of Placement:</b> Intersection of Lee Rd and County Line Rd	<b>Concrete Temp (°f):</b> 60
<b>Number of Samples Cast:</b> 5	<b>Air Content (%):</b> 4.0
<b>Ambient Temp (°f):</b> 48	<b>Unit Weight (pcf):</b> 144.0
<b>Slump (in.):</b> 1.5	<b>Water Added (gal.):</b> N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
A	01/20/2026	01/20/2026	7	3.97	12.38	60536	4890	163.0	Type 3
B	02/10/2026	02/10/2026	28	3.96	12.35	77551	6280	209.3	Type 2
C	02/10/2026	02/10/2026	28	3.95	12.25	75187	6140	204.7	Type 2
D	02/10/2026	02/10/2026	28	3.95	12.25	73281	5980	199.3	Type 5
E	03/11/2026	03/11/2026	56	3.95	12.25	91778	7490	249.7	Type 2

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

**(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed**

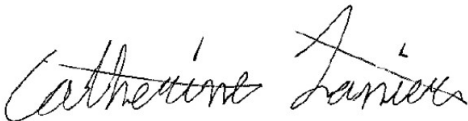

Catherine Lanier  
 Lab Manager



Kenneth Mosman