

Date : 03/23/2026
Project No : 2026C115-WO 1
Client Company : WSP
Arrival Time : 03/23/2026 23:00
Onsite Hours : 07:00

ASEC Report ID : 91977
Name of the Project : Lanier Islands Parkway
Project Location : Buford
Weather : N/A
Departure Time : 03/24/2026 06:
ASEC Technician Name : Zabihullah Lodin

Location(S): 10/810 cu. yd., 110/810 cu. yd., 210/810 cu. yd., 310/810 cu. yd., 410/810 cu. yd., 510/810 cu. yd., 610/810 cu. yd., 710/810 cu. yd., 810/810 cu. yd.,

Testing: 10 Set of concrete specimens (5 per set) were cast during the cast-in-place concrete pour at the above referenced location, in accordance with ASTM C31. The specimen will remain on site for the initial 24-48 hrs curing.

Compliance: ☒ Field placement of concrete appeared to be in general accordance with the project specifications (i.e., slump, temperature, etc) (refer to remarks below)
☐ Deviations and/or noncompliances were noted during the field placement (refer to remarks below)

Specimen Pick Up: 10 Sets of concrete specimens/ 5 specimen per set were picked up & transported to AS Engineering and Consulting LLC (ASEC) for curing and testing in accordance with ASTM C39, C670/1231

Field Curing: Specimen were stored for the initial 24 hours
☒ Near the poured structure
☐ In an insulated curing box
☐ Other

Remarks:

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.

Date : 03/23/2026
Project No : 2026C115-WO 1
Client Company : WSP
Arrival Time : 03/23/2026 23:00
Onsite Hours : 07:00

ASEC Report ID : 91977
Name of the Project : Lanier Islands Parkway
Project Location : Buford
Weather : N/A
Departure Time : 03/24/2026 06:
ASEC Technician Name : Zabihullah Lodin

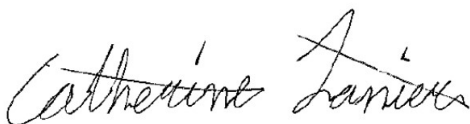
PLACEMENT INFORMATION - Cylinder

Set Number: A	Laboratory Number: 2026-066
Date Sampled: 03/23/2026	Time Sampled: 23:10
Sampled By: Zabihullah Lodin	Concrete Supplier: N/A
Contractor: N/A	Mix ID: N/A
Truck Number: N/A	Quantity of Load: N/A
Time Batched: N/A	Specified Strength: N/A
Location of Placement: 10/810 cu. yd.	Concrete Temp (°f): 70
Number of Samples Cast: 5	Air Content (%): 1.8
Ambient Temp (°f): 58	Unit Weight (pcf): 147.2
Slump (in.): 3.5	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	03/30/2026	03/30/2026	7	4.00	12.57	47630	3790	N/A	Type 6
2	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
3	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
4	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
5	05/18/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed


Catherine Lanier
Lab Manager


Kenneth Mosman

Date : 03/23/2026
Project No : 2026C115-WO 1
Client Company : WSP
Arrival Time : 03/23/2026 23:00
Onsite Hours : 07:00

ASEC Report ID : 91977
Name of the Project : Lanier Islands Parkway
Project Location : Buford
Weather : N/A
Departure Time : 03/24/2026 06:
ASEC Technician Name : Zabihullah Lodin

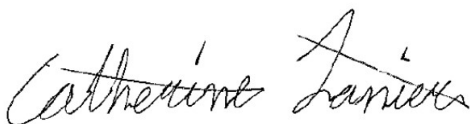
PLACEMENT INFORMATION - Cylinder

Set Number: B	Laboratory Number: 2026-066
Date Sampled: 03/23/2026	Time Sampled: 23:35
Sampled By: Zabihullah Lodin	Concrete Supplier: N/A
Contractor: N/A	Mix ID: N/A
Truck Number: N/A	Quantity of Load: N/A
Time Batched: N/A	Specified Strength: N/A
Location of Placement: 110/810 cu. yd.	Concrete Temp (°f): 67
Number of Samples Cast: 5	Air Content (%): 1.6
Ambient Temp (°f): 54	Unit Weight (pcf): 145
Slump (in.): 6	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	03/30/2026	03/30/2026	7	4.00	12.57	46356	3690	N/A	Type 5
2	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
3	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
4	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
5	05/18/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed


Catherine Lanier
Lab Manager


Kenneth Mosman

Date : 03/23/2026
Project No : 2026C115-WO 1
Client Company : WSP
Arrival Time : 03/23/2026 23:00
Onsite Hours : 07:00

ASEC Report ID : 91977
Name of the Project : Lanier Islands Parkway
Project Location : Buford
Weather : N/A
Departure Time : 03/24/2026 06:
ASEC Technician Name : Zabihullah Lodin

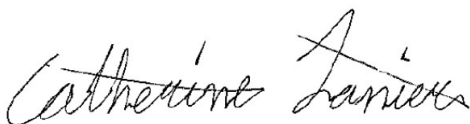
PLACEMENT INFORMATION - Cylinder

Set Number: C	Laboratory Number: 2026-066
Date Sampled: 03/23/2026	Time Sampled: 01:25
Sampled By: Zabihullah Lodin	Concrete Supplier: N/A
Contractor: N/A	Mix ID: N/A
Truck Number: N/A	Quantity of Load: N/A
Time Batched: N/A	Specified Strength: N/A
Location of Placement: 210/810 cu. yd.	Concrete Temp (°f): 65
Number of Samples Cast: 5	Air Content (%): 2.2
Ambient Temp (°f): 54	Unit Weight (pcf): 144.3
Slump (in.): 5	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	03/30/2026	03/30/2026	7	4.00	12.57	44375	3530	N/A	Type 5
2	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
3	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
4	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
5	05/18/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed


Catherine Lanier
Lab Manager


Kenneth Mosman

Date : 03/23/2026
Project No : 2026C115-WO 1
Client Company : WSP
Arrival Time : 03/23/2026 23:00
Onsite Hours : 07:00

ASEC Report ID : 91977
Name of the Project : Lanier Islands Parkway
Project Location : Buford
Weather : N/A
Departure Time : 03/24/2026 06:
ASEC Technician Name : Zabihullah Lodin

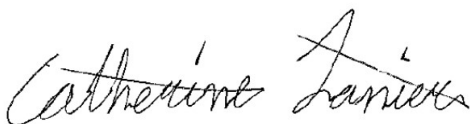
PLACEMENT INFORMATION - Cylinder

Set Number: D	Laboratory Number: 2026-066
Date Sampled: 03/23/2026	Time Sampled: 01:35
Sampled By: Zabihullah Lodin	Concrete Supplier: N/A
Contractor: N/A	Mix ID: N/A
Truck Number: N/A	Quantity of Load: N/A
Time Batched: N/A	Specified Strength: N/A
Location of Placement: 310/810 cu. yd.	Concrete Temp (°f): 66
Number of Samples Cast: 5	Air Content (%): 1.8
Ambient Temp (°f): 52	Unit Weight (pcf): 146.5
Slump (in.): 3.25	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	03/30/2026	03/30/2026	7	4.00	12.57	51969	4130	N/A	Type 6
2	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
3	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
4	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
5	05/18/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed


Catherine Lanier
Lab Manager


Kenneth Mosman

Date : 03/23/2026
Project No : 2026C115-WO 1
Client Company : WSP
Arrival Time : 03/23/2026 23:00
Onsite Hours : 07:00

ASEC Report ID : 91977
Name of the Project : Lanier Islands Parkway
Project Location : Buford
Weather : N/A
Departure Time : 03/24/2026 06:
ASEC Technician Name : Zabihullah Lodin

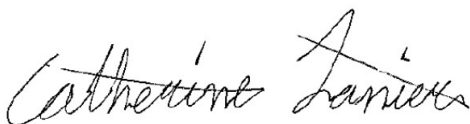
PLACEMENT INFORMATION - Cylinder

Set Number: E	Laboratory Number: 2026-066
Date Sampled: 03/23/2026	Time Sampled: 01:55
Sampled By: Zabihullah Lodin	Concrete Supplier: N/A
Contractor: N/A	Mix ID: N/A
Truck Number: N/A	Quantity of Load: N/A
Time Batched: N/A	Specified Strength: N/A
Location of Placement: 410/810 cu. yd.	Concrete Temp (°f): 66
Number of Samples Cast: 5	Air Content (%): 1.6
Ambient Temp (°f): 52	Unit Weight (pcf): 146.5
Slump (in.): 4	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	03/30/2026	03/30/2026	7	4.00	12.57	49119	3910	N/A	Type 2
2	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
3	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
4	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
5	05/18/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed


Catherine Lanier
Lab Manager


Kenneth Mosman

Date : 03/23/2026
Project No : 2026C115-WO 1
Client Company : WSP
Arrival Time : 03/23/2026 23:00
Onsite Hours : 07:00

ASEC Report ID : 91977
Name of the Project : Lanier Islands Parkway
Project Location : Buford
Weather : N/A
Departure Time : 03/24/2026 06:
ASEC Technician Name : Zabihullah Lodin

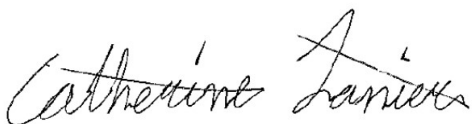
PLACEMENT INFORMATION - Cylinder

Set Number: F	Laboratory Number: 2026-066
Date Sampled: 03/23/2026	Time Sampled: 02:35
Sampled By: Zabihullah Lodin	Concrete Supplier: N/A
Contractor: N/A	Mix ID: N/A
Truck Number: N/A	Quantity of Load: N/A
Time Batched: N/A	Specified Strength: N/A
Location of Placement: 510/810 cu. yd.	Concrete Temp (°f): 65
Number of Samples Cast: 5	Air Content (%): 1.7
Ambient Temp (°f): 52	Unit Weight (pcf): 146
Slump (in.): 4.5	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	03/30/2026	03/30/2026	7	4.00	12.57	52007	4140	N/A	Type 2
2	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
3	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
4	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
5	05/18/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed


Catherine Lanier
Lab Manager


Kenneth Mosman

Date : 03/23/2026
Project No : 2026C115-WO 1
Client Company : WSP
Arrival Time : 03/23/2026 23:00
Onsite Hours : 07:00

ASEC Report ID : 91977
Name of the Project : Lanier Islands Parkway
Project Location : Buford
Weather : N/A
Departure Time : 03/24/2026 06:
ASEC Technician Name : Zabihullah Lodin

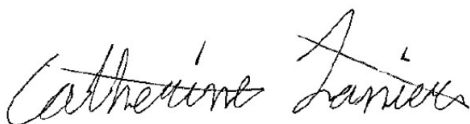
PLACEMENT INFORMATION - Cylinder

Set Number: G	Laboratory Number: 2026-066
Date Sampled: 03/23/2026	Time Sampled: 03:27
Sampled By: Zabihullah Lodin	Concrete Supplier: N/A
Contractor: N/A	Mix ID: N/A
Truck Number: N/A	Quantity of Load: N/A
Time Batched: N/A	Specified Strength: N/A
Location of Placement: 610/810 cu. yd.	Concrete Temp (°f): 65
Number of Samples Cast: 5	Air Content (%): 1.6
Ambient Temp (°f): 54	Unit Weight (pcf): 146.3
Slump (in.): 6	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	03/30/2026	03/30/2026	7	4.00	12.57	49135	3910	N/A	Type 2
2	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
3	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
4	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
5	05/18/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed


Catherine Lanier
Lab Manager


Kenneth Mosman

Date : 03/23/2026
Project No : 2026C115-WO 1
Client Company : WSP
Arrival Time : 03/23/2026 23:00
Onsite Hours : 07:00

ASEC Report ID : 91977
Name of the Project : Lanier Islands Parkway
Project Location : Buford
Weather : N/A
Departure Time : 03/24/2026 06:
ASEC Technician Name : Zabihullah Lodin

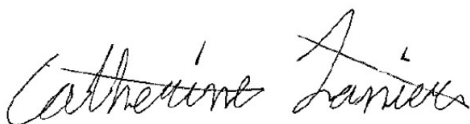
PLACEMENT INFORMATION - Cylinder

Set Number: H	Laboratory Number: 2026-066
Date Sampled: 03/23/2026	Time Sampled: 04:07
Sampled By: Zabihullah Lodin	Concrete Supplier: N/A
Contractor: N/A	Mix ID: N/A
Truck Number: N/A	Quantity of Load: N/A
Time Batched: N/A	Specified Strength: N/A
Location of Placement: 710/810 cu. yd.	Concrete Temp (°f): 64
Number of Samples Cast: 5	Air Content (%): 1.5
Ambient Temp (°f): 50	Unit Weight (pcf): 144
Slump (in.): 6.25	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	03/30/2026	03/30/2026	7	4.00	12.57	44867	3570	N/A	Type 5
2	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
3	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
4	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
5	05/18/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed


Catherine Lanier
Lab Manager


Kenneth Mosman

Date : 03/23/2026
Project No : 2026C115-WO 1
Client Company : WSP
Arrival Time : 03/23/2026 23:00
Onsite Hours : 07:00

ASEC Report ID : 91977
Name of the Project : Lanier Islands Parkway
Project Location : Buford
Weather : N/A
Departure Time : 03/24/2026 06:
ASEC Technician Name : Zabihullah Lodin

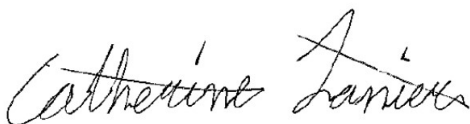
PLACEMENT INFORMATION - Cylinder

Set Number: I	Laboratory Number: 2026-066
Date Sampled: 03/23/2026	Time Sampled: 05:57
Sampled By: Zabihullah Lodin	Concrete Supplier: N/A
Contractor: N/A	Mix ID: N/A
Truck Number: N/A	Quantity of Load: N/A
Time Batched: N/A	Specified Strength: N/A
Location of Placement: 810/810 cu. yd.	Concrete Temp (°f): 64
Number of Samples Cast: 5	Air Content (%): 1.5
Ambient Temp (°f): 50	Unit Weight (pcf): 146
Slump (in.): 5	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	03/30/2026	03/30/2026	7	4.00	12.57	44049	3500	N/A	Type 2
2	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
3	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
4	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
5	05/18/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed


Catherine Lanier
Lab Manager


Kenneth Mosman

Date : 03/23/2026
Project No : 2026C115-WO 1
Client Company : WSP
Arrival Time : 03/23/2026 23:00
Onsite Hours : 07:00

ASEC Report ID : 91977
Name of the Project : Lanier Islands Parkway
Project Location : Buford
Weather : N/A
Departure Time : 03/24/2026 06:
ASEC Technician Name : Zabihullah Lodin

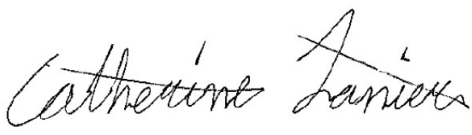
PLACEMENT INFORMATION - Cylinder

Set Number: J	Laboratory Number: 2026-066
Date Sampled: 03/23/2026	Time Sampled: N/A
Sampled By: Zabihullah Lodin	Concrete Supplier: N/A
Contractor: N/A	Mix ID: N/A
Truck Number: N/A	Quantity of Load: N/A
Time Batched: N/A	Specified Strength: N/A
Location of Placement: N/A	Concrete Temp (°f): N/A
Number of Samples Cast: 5	Air Content (%): N/A
Ambient Temp (°f): N/A	Unit Weight (pcf): N/A
Slump (in.): N/A	Water Added (gal.): N/A

Specimen Number	Scheduled Test Date	Date Tested	Age (Days)	Dia (in.)	Area (sq in.)	Max Load (lbf)	Strength (psi)	% Design Strength	Fracture Type
1	03/30/2026	03/30/2026	7	4.00	12.57	45805	3640	N/A	Type 2
2	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
3	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
4	04/20/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
5	05/18/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

UNLESS OTHERWISE SPECIFIED, TESTS WERE PERFORMED IN ACCORDANCE WITH ASTM METHODS C31, C39, C138, C143, C173, C1064.

(1) Cone (2) Cone-split (3) Vertical (4) Shear (5) Edge Fracture (6) Pointed


Catherine Lanier
Lab Manager


Kenneth Mosman